

8485

NOTE: Installation may require two people.

8472 Parts List

Large "L" 111311 В 3/8-16 x 1" FHSCS 701124 С 1/4-20 x 1/2" PhPHS 700435 Small "L" 111312 Ε Spacer 701544 1/2-13 x 3" Set Screw 701126

8485 Parts List

Thru Mount Base Plate 110978	A
1/4-20 x 2-1/2" Hex Head Bolt 711570	B
Thru Mount Washer 711872	c
Thru Mount Nut 711571	D




How to remove freestanding mount from Winston Workstation.




Lower Winston work surface to its lowest position.


If monitors are installed, **remove all monitors with connected tilter assemblies** as shown. Keep washers and screws. These will be used to reinstall the monitor after mount assembly is complete.

Remove all items from Winston work surface.

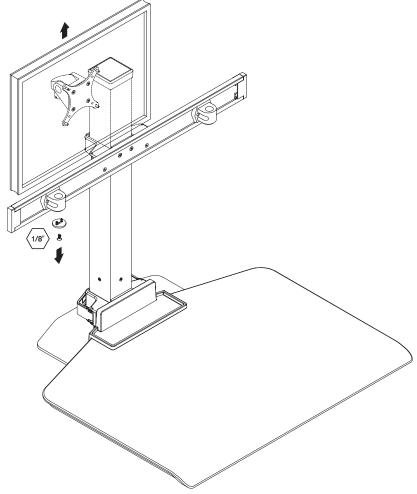

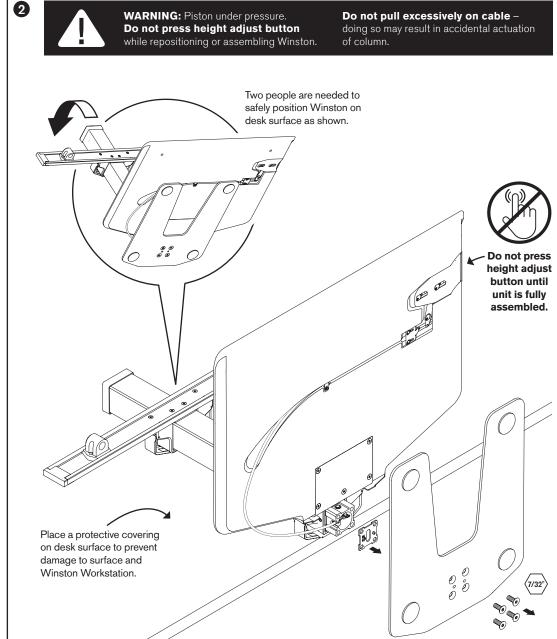

8472 | CLAMP MOUNT

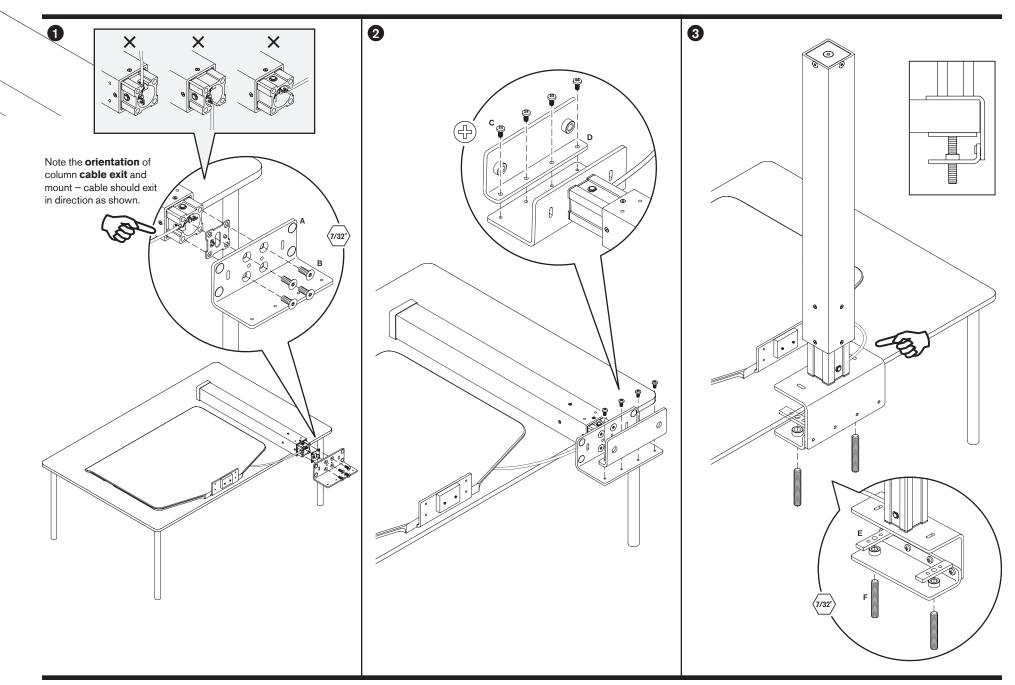

8485 | THRU MOUNT

