


This product is UL Listed. It must be installed by a qualified professional installer.

Maximum UL Load Capacity: 200 lb (91 kg)

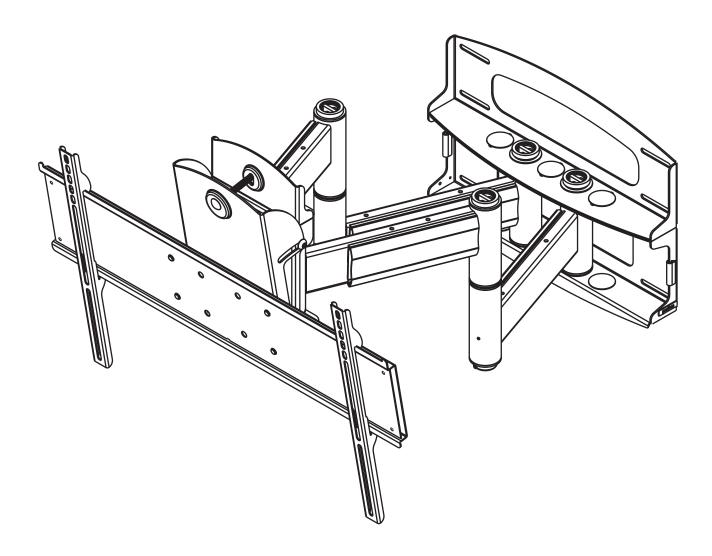

Read instruction sheet before you start installation and assembly.

A WARNING

- Do not begin to install your Peerless product until you have read and understood the instructions and warnings contained in this Installation Sheet. If you have any questions regarding any of the instructions or warnings, please call Peerless customer care at 1-800-729-0307.
- This product should only be installed by a qualified professional.
- Make sure that the supporting surface will safely support the combined load of the equipment and all attached hardware and components.
- Never exceed the Maximum Load Capacity of 200 lb (91 kg).
- Do not attach directly to a metal stud wall. Use of a triple stud WSP wall plate is required for attachment to metal studs (contact customer care). Metal stud installation is not UL evaluated.
- If mounting to wood wall studs, make sure that mounting screws are anchored into the center of the studs. Use of an "edge to edge" stud finder is highly recommended.
- Always use an assistant or mechanical lifting equipment to safely lift and position equipment.
- Tighten screws and nuts firmly, but <u>do not overtighten</u>. Overtightening can damage the items, greatly reducing their holding power.

IMPORTANT! Certain types of walls require additional mounting hardware...

WALL CONSTRUCTION ADDITIONAL HARDWARE REQUIRED

Wood Stud, Wood Beam none
Concrete none

Metal stud WSP716, WSP716-S, WSP724, or WSP724-S

Other or unsure? Contact Customer Care

IMPORTANT! Turn to the appropriate page for your wall installation.

Installations:

To Wood Stud Walls	page	: 6


To Concrete Walls page 7

Tools Needed for Assembly

- stud finder ("edge to edge" stud finder is recommended)
- drill
- 7/32" drill bit for wood studs
- 5/16" masonry drill bit for concrete
- 7/16" socket wrench with extension (recommended)
- level
- · phillips screwdriver
- 3/4" open-end wrench


Accessories

 External Wall Plate (WSP716, WSP716-S, WSP724, WSP724-S) (Metal Stud not evaluated by UL)

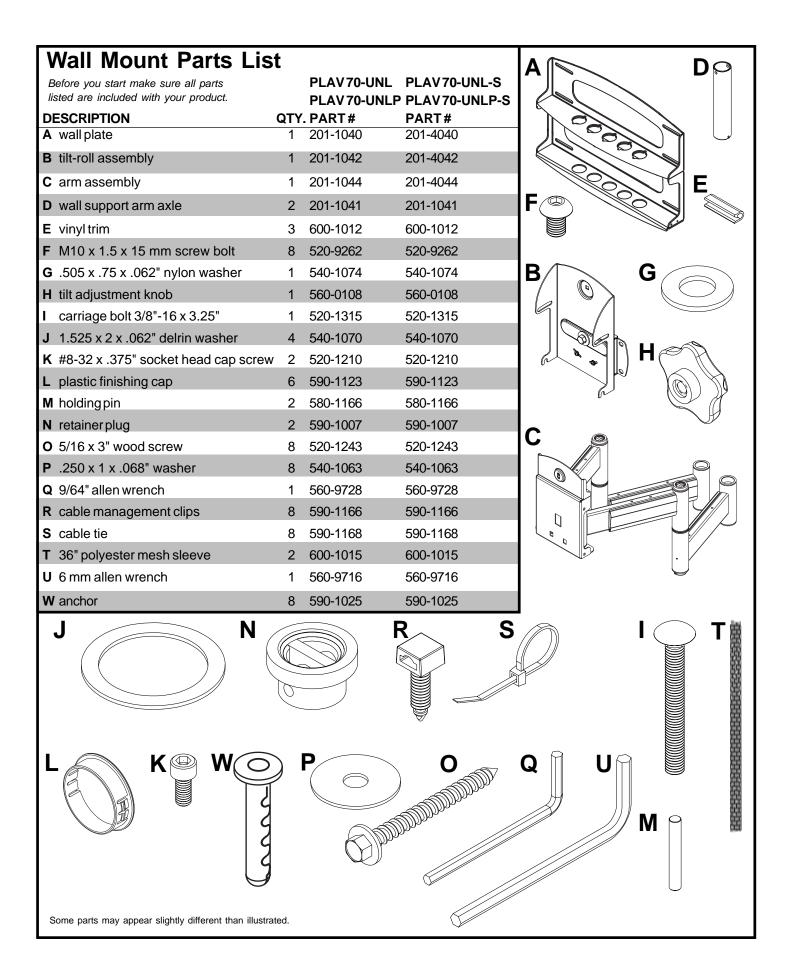


Before you begin, make sure all parts shown are included with your product.


Adapter Bracket Parts Lis	t	PLAV 70-UNL	PLAV 70-UNL-S	PLAV 70-UNLP	PLAV 70-UNLP-S
Description	Qty	Part #	Part #	Part #	Part #
AA adapter bracket	1	201-1110	201-4110	201-1110	201-4110
BB shallow adapter bracket	2	200-0756	200-0757	200-0754	200-0755
CC deep adapter bracket	2	200-0752	200-0753	200-0750	200-0751
DD allen wrench	1	560-9646	560-9646	560-0072	560-0072

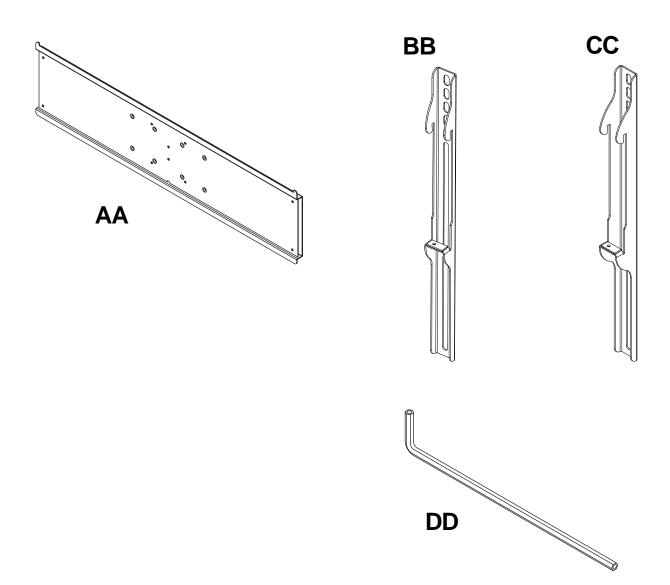

Security Adapter Bracket Fasteners

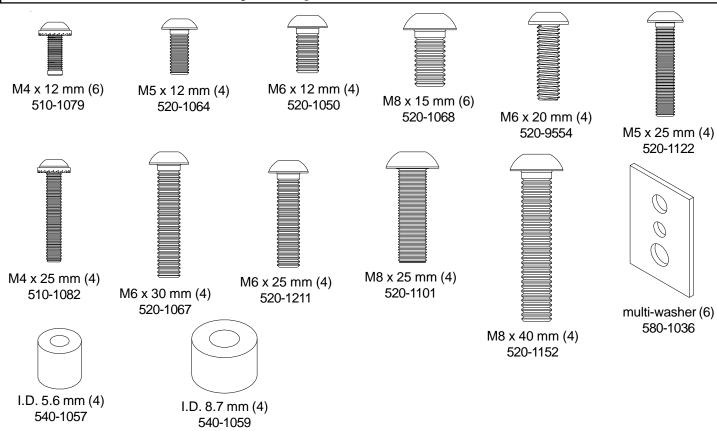


Phillips Adapter Bracket Fasteners

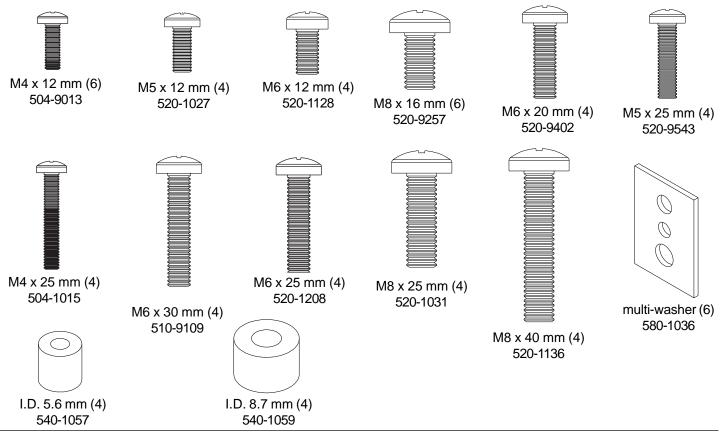

- Installer must verify that the supporting surface will safely support the combined load of the equipment and all attached hardware and components.
- Tighten wood screws so that wall plate is firmly attached, but do not overtighten. Overtightening can damage the screws, greatly reducing their holding power.
- Never tighten in excess of 80 in. lb (9 N.M.).
- Do not attach directly to a metal stud wall. Use of a triple stud WSP wall plate is required for attachment to metal studs (contact customer care). Metal stud installation is not UL evaluated.
- Make sure that mounting screws are anchored into the center of the stud. The use of an "edge to edge" stud finder is highly recommended.
- Hardware provided is for attachment of mount through standard thickness drywall or plaster into wood studs. Installers are responsible to provide hardware for other types of mounting situations.
- Never exceed the Maximum UL Load Capacity of 200 lb (91 kg).


Wall plate (A) can be mounted to two studs that are 16" apart. Use a stud finder to locate the edges of the studs. Use of an edge-to-edge stud finder is highly recommended. Based on their edges, draw a vertical line down each stud's center. Place wall plate on wall as a template. The top mounting slots should be located .43" below the desired screen center. Level plate, and mark the center of the eight mounting holes. Make sure that the mounting holes are on the stud centerlines. Drill eight 7/32" dia. holes 3" deep. Make sure that the wall plate is level, secure it using eight 5/16 x 3" wood screws (O) and washers (P).

Skip to step 2 on page 8.

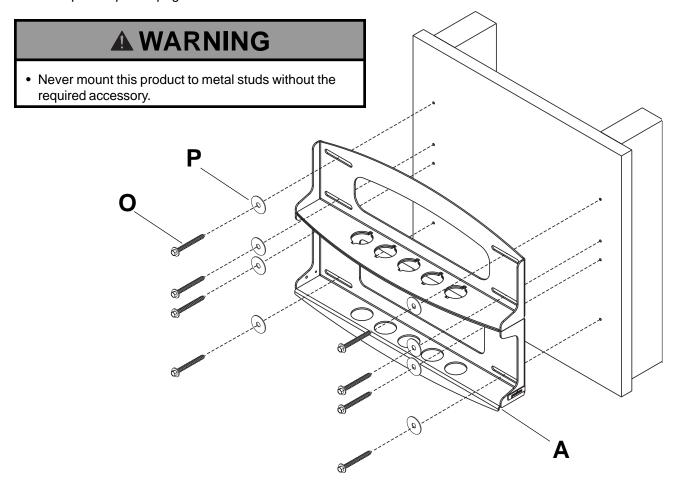

- Concrete must be 2000 psi density minimum. Lighter density concrete may not hold concrete anchor.
- Make sure that the supporting surface will safely support the combined load of the equipment and all attached hardware and components.
- Never exceed the Maximum UL Load Capacity of 200 lb (91 kg).

IMPORTANT! Concrete must be 2000 psi density minimum.

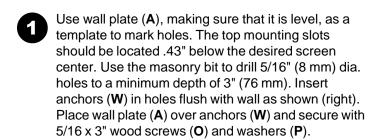


A WARNING

- Tighten wood screws so that wall plate is firmly attached, but do not <u>overtighten</u>. Overtightening can damage screws, greatly reducing their holding power.
- Never tighten in excess of 80 in lb (9 N.M.).


WARNING


- Always attach concrete expansion anchors <u>directly</u> to load-bearing concrete.
- Never attach concrete expansion anchors to concrete covered with plaster, drywall, or other finishing material. If mounting to concrete surfaces covered with a finishing surface is unavoidable, the finishing surface must be counterbored as shown below. If plaster/ drywall is thicker than 5/8", custom fasteners must be supplied by installer (Not UL evaluated).

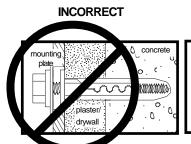


CUTAWAY VIEW





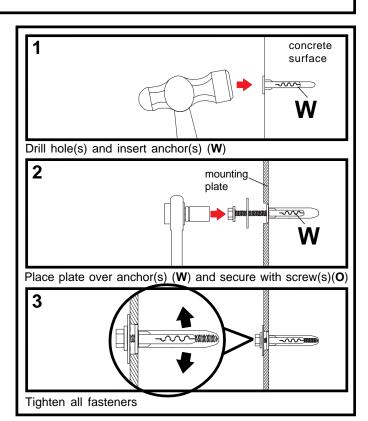


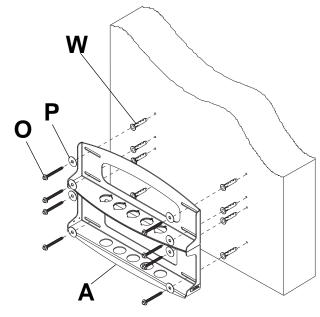


- If you are uncertain that product is properly installed, call customer care.
- Note: There are three mounting positions. The center position is shown right. Arm assemblies must be mounted with one mounting hole separating them. Slide washers (J) over wall support arm axles (D). Next, insert plastic caps (N) into axles. Then, insert holding pins (M) into axles. See detail 1.
- Place arm assembly (C) with washers (J) into wall plate (A). Insert axle assemblies shown in detail 1 through wall plate (A), arm assembly (C), and washers (J). Lock axles in place by aligning holding pins (M) with notches shown in detail 2.
- Insert socket cap screws (**K**) into hole at bottom of wall support arm axles (**D**) as shown in detail 3.

 Tighten screw using 9/64" allen wrench (**Q**).


Note: Fit of axles (**D**) into wall plate (**A**) and arm assembly (**C**) will be tight. Gently tap into place with a hammer if necessary.

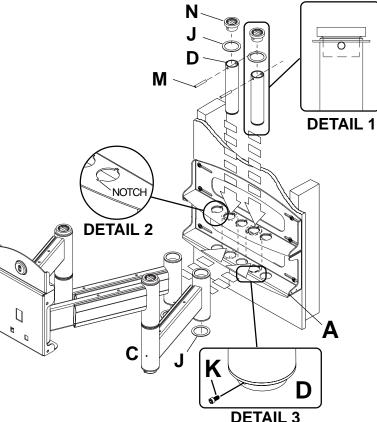

- To route cables through cord management channels: Slide one mesh sleeve (T) over each cable. Use cable ties (S) to tighten mesh sleeves to cables.
- Pull cords through cord management channels, leaving enough slack to allow full range of movement for swing arm assembly (**C**) as shown if figure 3.1.
- To route cables using cable management clips: Snap eight cable management clips(R) into both swing arms(C) as shown in figure 3.2. Cable ties (S) are used with clips for cord management.
- Slide one mesh sleeve (T) over each cable. Use cable ties (S) to tighten mesh sleeves to cables.

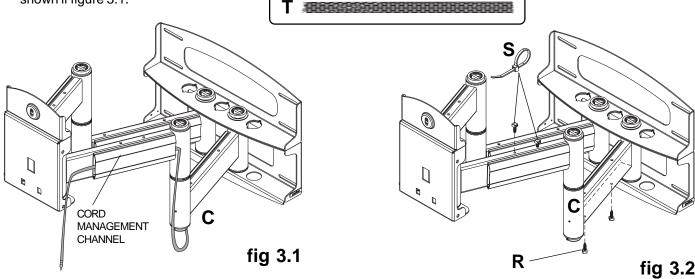


- Attach two pieces of vinyl trim (E) to wall plate (A). Next, attach one piece of vinyl trim to bottom of swivel box on arm assembly (C).
- Insert one finishing cap (L) into each unused hole of wall plate (A).

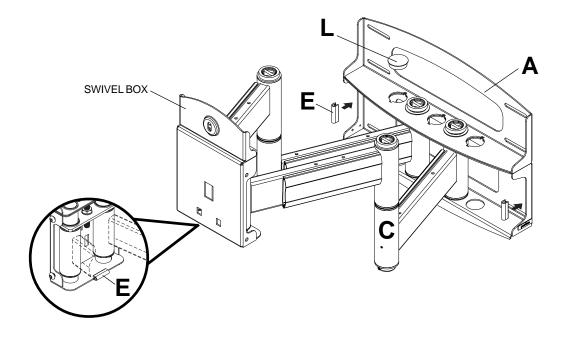


Insert and tape carriage bolt (I) into top hole of tilt-roll assembly (B). Attach tilt-roll assembly to adapter bracket (AA) with four M10 socket screws (F). Tighten screws using 6 mm allen wrench (U).


CAUTION

• Do not overtighten screws! Overtightening may hinder roll option.

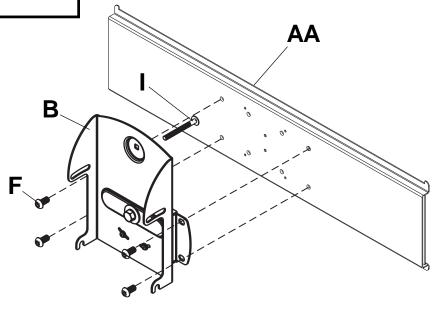


• Use an assistant or mechanical lifting equipment to safely lift and position the plasma TV.



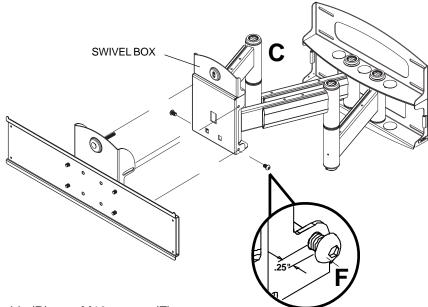


- Hook tilt-roll assembly (B) onto M10 screws (F). Insert carriage bolt (I) into slot of swivel box as shown in figure 6.1. Install nylon washer (G) and tilt adjustment knob (H).
- Install remaining two M10 screws (**F**) as shown in figure 6.2. HAND TIGHTEN all four M10 screws to allow for tilt adjustment. Remove tape from carriage bolt (**I**). For tilt adjustment, gently push back on the top of plasma to relieve pressure on knob. Adjust tilt to desired position and tighten tilt adjustment knob (**H**), then securely tighten all four M10 screws (**F**) using 6 mm allen wrench (**U**).

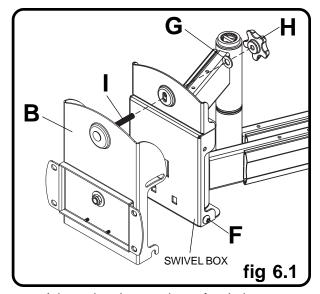

Adapter bracket not shown for clarity.

CAUTION

• After tilt is adjusted, all fasteners <u>must</u> be tightened. Failure to do so will result in damage to the mount.

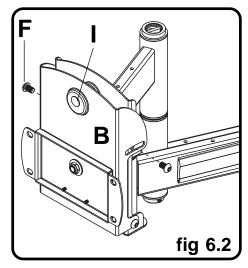

Adapter bracket not shown for clarity.

Installing Adapter Brackets

Refer to Screen Compatibility Chart to determine the proper fasteners to use.



To prevent scratching the screen, set a cloth on a flat, level surface that will support the weight of the screen. Place screen face side down. If screen has knobs on the back, remove them to allow the adapter brackets to be attached. Place adapter brackets (**BB or CC**) on back of screen, align to holes, and center on back of screen as shown in figure 7.1. Attach the adapter brackets to the back of the screen using the appropriate combination of screws, multi-washers, and spacers as shown in figure 7.3.

Note: Top and bottom holes must always be used.

Verify that all holes are properly aligned, and then tighten screws using a phillips screwdriver.

Note: If using security screws, tighten using security allen wrench (**DD**).

WARNING

 Tighten screws so adapter brackets are firmly attached. Do not tighten with excessive force.
 Overtightening can cause stress damage to screws, greatly reducing their holding power and possibly causing screw heads to become detached. Tighten to 40 in. • lb (4.5 N.M.) maximum torque.

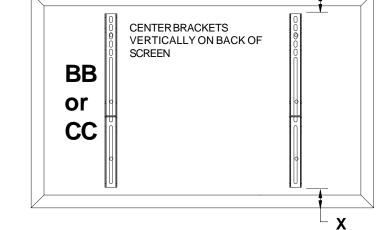


fig 7.1


Note: "X" dimensions should be equal.


Notes:

- The number of fasteners used will vary, depending upon the type of screen.
- Multi-washers and spacers may not be used, depending upon the type of screen.
- Use the corresponding hole in the multiwasher that matches your screw size as shown in figure 7.2.

WARNING

 If screws don't get three complete turns in the screen inserts or if screws bottom out and bracket is still not tightly secured, damage may occur to screen or product may fail.

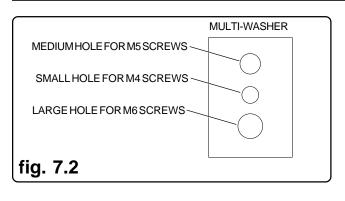

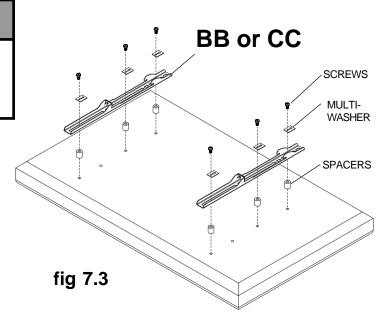

Mounting and Removing Flat Panel Screen

Refer to mount instruction sheet for attachment of adapter bracket to mount.




Hook adapter brackets (**BB or CC**) onto adapter bracket (**AA**), then slowly swing screen in as shown. Turn screws clockwise at least six times to prevent screen from being removed as shown in detail 4. Tighten using allen wrench (**DD**). Screen can be adjusted horizontally if desired.

Note: To lock the screen down, tighten screws to adapter bracket as shown in detail 4.

To remove screen from mount, loosen screws, swing screen away from mount, and lift screen off of mount.


A WARNING

• Always use an assistant or mechanical lifting equipment to safely lift and position the plasma television.

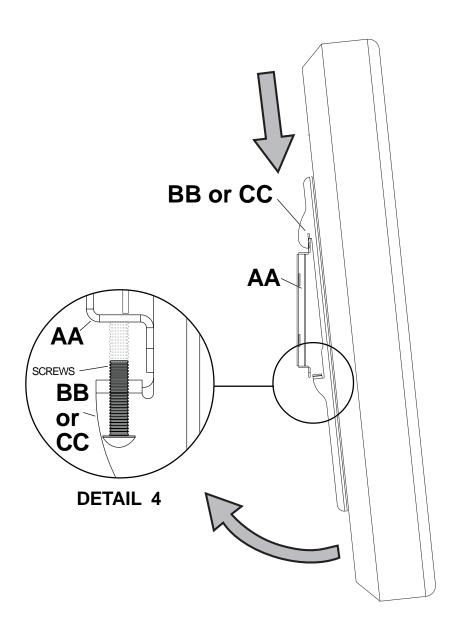

Depending on the specific size & weight of the plasma, articulating swing arm may be angled at different positions, causing plasma to appear to lean sideways at different articulating positions. Tilt-roll assembly (B) allows plasma to be manually adjusted, so plasma can be horizontal at all positions. To adjust, gently rotate

plasma by hand to desired position.

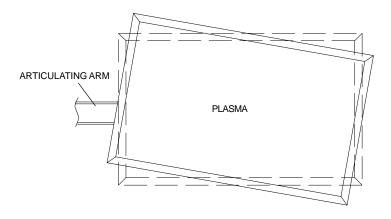

9-1 If it is too difficult to adjust roll of plasma, loosen screws shown in figure 9.1 using a phillips screwdriver.

IMPORTANT! Do not loosen or tighten screws more than 1/8 turn.

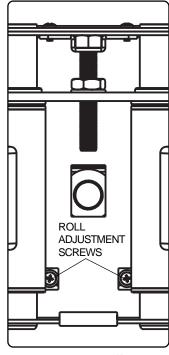


fig 9.1

- Position of screen may be adjusted vertically up to .79" in each direction by doing the following:
 - To raise screen, turn hex nut shown in figure 10.1 clockwise with 3/4" open-end wrench (not provided).
 - To lower screen, turn hex nut shown in figure 10.1 counterclockwise with 3/4" open-end wrench (not provided).

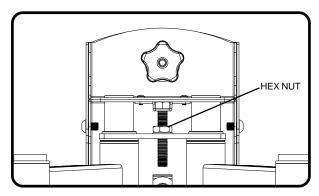


fig 10.1